

K-720DV Instruction Manual Vise Installation



1.- Vise base used in all applications



2.- Base only for 50DN 600 series, mounts on #1




3.- Base, mounting plate and pulley for 50DN 600 series





4.- # 2 and # 3 mounted on # 1, showing housing only of 50DN

K-720DV Accessories

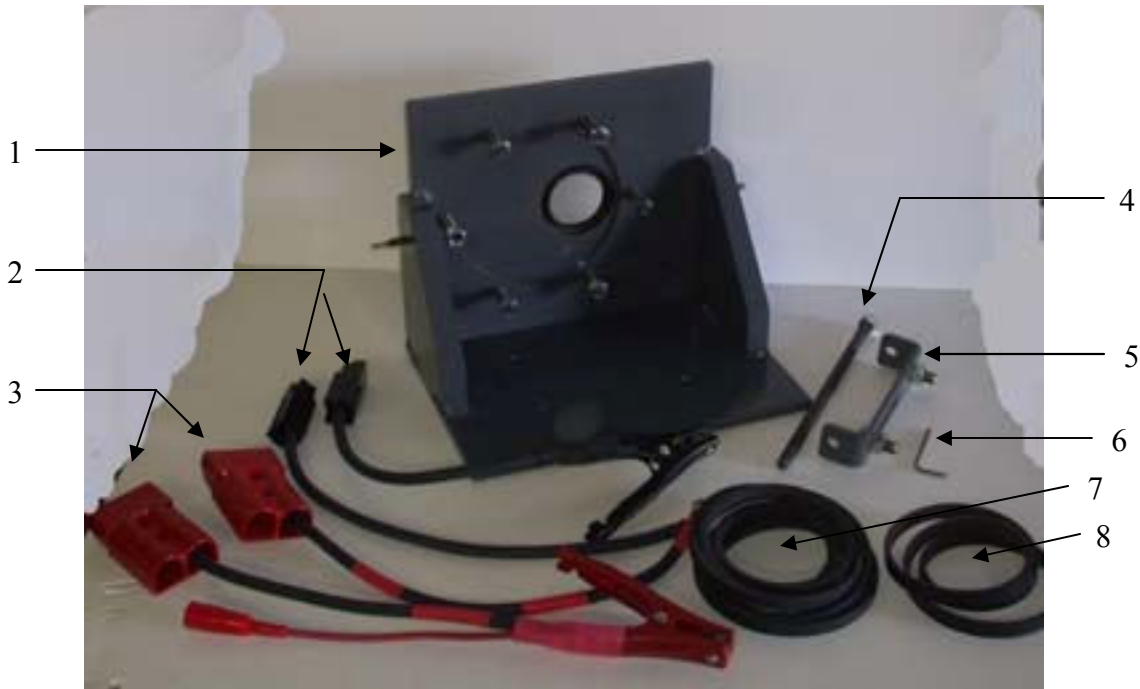

- 1.- Base for 50DN type 600
- 2.- Leads to alternator (-) ground.
- 3.- Leads to alternator (+) positive
- 4.- Rod for 50DN type 500.
- 5.- Bracket for 50DN type 500
- 6.- Allen key.
- 7.- 2 V-belts.
- 8.- Serpentine belt.
- 9.- Vise for standard alternators.
- 10.- 27 test leads (not show).
- 11.- Pulley for 50DN type 600

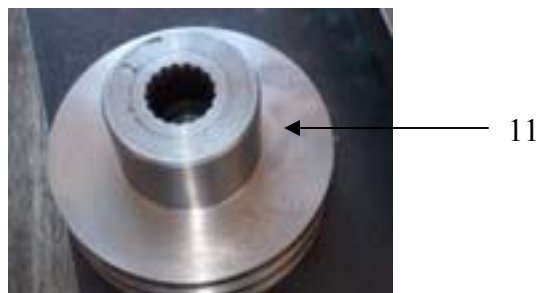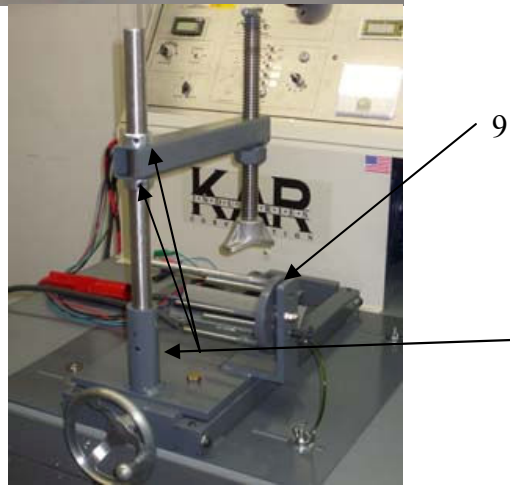

K-720DV Instruction Manual Vise Installation



5.- Regular mount # 8 with large post attached



6.- # 5 shown the large Niehoff mounted on it.



7.-# 6 with bracket to attach to 50DN 500 series.



8.- Regular mounting vise with turret for standard alternators